
Schedule of Accreditation

issued by

United Kingdom Accreditation Service

2 Pine Trees, Chertsey Lane, Staines-upon-Thames, TW18 3HR, UK

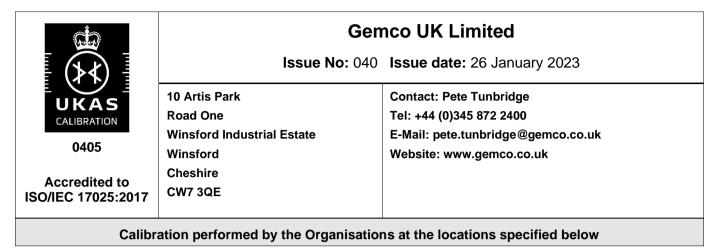

Locations covered by the organisation and their relevant activities

Laboratory Locations:

Location details		Activity	Location code
Address 10 Artis Park Road One Winsford Industrial Estate Winsford Cheshire CW7 3QE	Local contact Pete Tunbridge Tel: +44 (0)345 872 2400 E-Mail: pete.tunbridge@gemco.co.uk Website: www.gemco.co.uk	Temperature (Electronic thermometers with sensors) Pressure	P P

Site activities performed away from the locations listed above*:

Location details	Activity	Location code
Customer Premises eg, MoT Test Centres, Garages, and Repair/Service Facilities (*including those of Gemco Service, Winsford)	Vehicle Exhaust Analyser (VEGA/DSM) Calibrations	S



Accredited to ISO/IEC 17025:2017

Schedule of Accreditation issued by United Kingdom Accreditation Service 2 Pine Trees , Chertsey Lane, Staines-upon-Thames , TW18 3HR, UK

Gemco UK Ltd

Issue No: 040 Issue date: 26 January 2023

Calibration performed by the Organisation at the locations specified

Calibration and Measurement Capability (CMC

Measured Quantity Instrument or Gauge	Range	Expanded Measurement Uncertainty ($k = 2$)	Remarks	Location Code		
Instruments approved by the Vehicle Inspectorate on behalf of the DfT for the measurement of:- a) vehicle exhaust emissions	As per Vehicle Inspectorate requirements:- VPB/07/24/20/CAL dated May 1995 (1 st revision August 1995)	3.0 % of reading	A list of individual approved signatories and the type of approved instruments they may calibrate is held by the laboratory and by UKAS.	S		
b) free acceleration smoke	MOT/08/19/01 dated October 2001 (3 rd revision January 2007)	0.10 m ⁻¹	Smoke obscuration coefficient	S		
TEMPERATURE						
Electronic thermometers with sensors, and temperature indicators	- 10 °C to + 100 °C	0.18 °C	In House Procedure WL403 12 th September 2018	Ρ		
PRESSURE						
Gas pressure (absolute)						
Calibration of indicating instruments and gauges	2.5 kPa to 160 kPa	29 Pa	Methods consistent with EURAMET CG17.	Ρ		
END						



Accredited to

Schedule of Accreditation issued by **United Kingdom Accreditation Service**

2 Pine Trees, Chertsey Lane, Staines-upon-Thames, TW18 3HR, UK

Gemco UK Ltd

Issue No: 040 Issue date: 26 January 2023

ISO/IEC 17025:2017 Calibration performed by the Organisation at the locations specified

Appendix - Calibration and Measurement Capabilities

Introduction

The definitive statement of the accreditation status of a calibration laboratory is the Accreditation Certificate and the associated Schedule of Accreditation. This Schedule of Accreditation is a critical document, as it defines the measurement capabilities, ranges and boundaries of the calibration activities for which the organisation holds accreditation.

Calibration and Measurement Capabilities (CMCs)

The capabilities provided by accredited calibration laboratories are described by the Calibration and Measurement Capability (CMC), which expresses the lowest measurement uncertainty that can be achieved during a calibration. If a particular device under calibration itself contributes significantly to the uncertainty (for example, if it has limited resolution or exhibits significant nonrepeatability) then the uncertainty quoted on a calibration certificate will be increased to account for such factors.

The CMC is normally used to describe the uncertainty that appears in an accredited calibration laboratory's schedule of accreditation and is the uncertainty for which the laboratory has been accredited using the procedure that was the subject of assessment. The measurement uncertainty is calculated according to the procedures given in the GUM and is normally stated as an expanded uncertainty at a coverage probability of 95 %, which usually requires the use of a coverage factor of k = 2. An accredited laboratory is not permitted to quote an uncertainty that is smaller than the published measurement uncertainty in certificates issued under its accreditation.

Expression of CMCs - symbols and units

It should be noted that the percentage symbol (%) represents the number 0.01. In cases where the measurement uncertainty is stated as a percentage, this is to be interpreted as meaning percentage of the measurand. Thus, for example, a measurement uncertainty of 1.5 % means $1.5 \times 0.01 \times q$, where q is the quantity value.

The notation Q[a, b] stands for the root-sum-square of the terms between brackets: Q[a, b] = $[a^2 + b^2]^{1/2}$